

## EIE INSTRUMENTS PVT. LTD.

www.eieinstruments.com, www.eiepharmatest.com, www.eieceratest.com, www.eiepetrotest.com



B-14, Zaveri Industrial Estate, Opp. Shyam-Villa Society, Near Saraswati Vidhyalaya, Kathwada GIDC road, Near Singarva Bus Stand, Off. National Highway, Ahmedabad – 382430, Gujarat, India Email : <u>service@eieinstruments.com</u> , <u>kunal@eieinstruments.com</u> Telephone: +91-79-66040613, +91-79-66040600

### **Organization's ISO 9001:2015 Certificate**



e-mail : info@robsecrification.co.in | website : www.robsecrification.co.in The Registration is not a Product Quality Certificate, "Subject to successful completion of surveillance audits, Visit for verification on www.robsecrtification.co.in Certificate is the property of ROHS and return when demanded



**Operation & Maintenance Instruction Manual** 

Equipment Name: Universal Testing Machine (Adhesive) Equipment Serial Number:

Document Number: EIE/OM/UTMA/01

Page No.: 2 of 21

### Forward

Dear valued customer,

We are thankful of you for your keen interest in our company products. We hope you enjoy using them and find them to be helpful and reliable. We greatly appreciate your business and the opportunity you have provided us to assist you. You have joined a selected group of customers who have switched to the technologically superior and quality enhanced laboratory testing products.

Time has changed, so does the technology. Your purchase lists you on the cutting edge of the 21<sup>st</sup> century technology. To help you get the most out of your EIE Instruments Pvt. Ltd. products, we have created this instruction manual that is an excellent way of expressing and maintaining your trust in EIE's - superior quality testing products. Our continued efforts and commitment are to provide you with the best and efficient services after sales, prompt attention and the highest level of customer satisfaction. If for any reasons, you have questions or comments, we are delighted to hear from you. We welcome your feedback for further improvement in our product(s). We would be happy to help you in any way we can. +91-9909903582 You can contact us on or send us an email at service@eieinstruments.com/kunal@eieinstruments.com. You can expect us to respond to your call or email within 24-48 working hours.

Once again, we would like to thank you for your trust and kind patronage. We look forward to serve you better in the future.

Yours sincerely, EIE Instruments Private Limited



## **Table of Contents**

Organization's ISO 9001:2015 Certificate2	
Forward3	
Table of Contents4	
Table of Figures5	
List of Tables	
1 Introduction to EIE – Universal Testing Machine	
1.1 General Product Descriptions	
1.2 Terminology	
1.2.1 Tensile Test	
1.2.2 Shear Test6	
1.2.3 Compression Test	
2 Technical Specification	
2.1 Introduction to EIE – Universal Testing Machine7	
3 Safety7	
3.1 Safety Instructions	
4 Installation of Universal Testing Machine (UTM)9	
4.1 Component Diagram of Universal Testing Machine (Digital Controller Based)10	
4.2 Electrical Circuit Diagram of Universal Testing Machine11	
5 Introduction to Digital Controller of Universal Testing Machine	
5.1 Operating Instruction of Digital Controller12	
5.2 Speed Setting Process	
6 Standard Operation Procedure15	
6.1 Determination of Tensile Adhesive Strength15	
6.2 Determination of Shear Adhesive Strength16	
6.3 Deformation Test	
7 Precautions to Followed	
Operation & Maintenance Instruction Manual	
<b>Equipment Name:</b> Universal Testing Machine (Adhesive) <b>Equipment Serial Number:</b>	

Document Number: EIE/OM/UTMA/01

Page No.: 4 of 21

anty Certificate
------------------

## **Table of Figures**

Figure 1 Component Diagram of UTM	10
Figure 2 Circuit Diagram of UTM	11
Figure 3 Home screen	13
Figure 4 Auto rev. function	13
Figure 5 Test Selection window	14
Figure 6 setting window	14
Figure 7 Speed checking screen	14
Figure 8 Test Grip for Tensile Adhesive test	15
Figure 9 Tensile test speed screen	15
Figure 10 Test grip for Shear adhesive test	16
Figure 11 Deformation test assembling	17

## **List of Tables**

Table 1 UTM Functional Keys12
-------------------------------

NH EB ANT & PAR	
EIE INSTRUMENTS PVT LTD	

Operation & Maintenance Ins	struction Manual
Equipment Name: Universal Testing Machine (Adhesive)	Equipment Serial Number:
Document Number: EIE/OM/UTMA/01	Page No.: 5 of 21

### **1** Introduction to EIE – Universal Testing Machine

**EIE – Universal Testing Machine (UTM)** is also known as universal tester, material testing machine or materials test frame. It is the most fundamental materials science and engineering tests that you can perform on any material. This test is performed on the material to determine how much tension, strain, compression etc. a material can handle; it also determines the breaking strength of the material. Many other properties that are measured by the Universal testing machine.

### 1.1 General Product Descriptions

**EIE – Universal Testing Machine (UTM)** is a benchtop model capable of performing tension, compression, shear and Flexure Tests. The unit consists of two load cells (i.e. 3000kg for Tensile/ Compression Test and 500 kg for Flexural (deformation) Test). Loading is accomplished by the lower crosshead (acting plate) being driven by double screw powered by an electronically controlled servo drive motor. Hard chrome plated columns maintain alignment of the crossheads.

Operation of the UTM is controlled by Digital Controller. A variety of accessories are available to provide added capability and flexibility as per test requirements. These include furnaces, ovens, Grips, fixtures and data acquisition etc. (On extra cost).

### 1.2 Terminology

### 1.2.1 Tensile Test

Tensile test is performed to determine the effectiveness and behaviour of a material when a stretching force acts on it.

### 1.2.2 Shear Test

Shear testing is performed to determine the shear strength of a material. It measures the maximum shear stress that may be sustained before a material will rupture. Shear testing is commonly used with adhesives and can be used in either a tensile or comprehensive method.

### 1.2.3 Compression Test

Compression test is the test in which a material experiences opposing forces that push inward upon the specimen from opposite sides or is otherwise compressed, "squashed", crushed, or flattened.



Operation & Maintenance Ins	struction Manual
Equipment Name: Universal Testing Machine (Adhesive)	Equipment Serial Number:
Document Number: EIE/OM/UTMA/01	Page No.: 6 of 21

### 2 Technical Specification

Capacity	:	Load Cell 1: 3000 KG & Load Cell 2: 500 KG
Speed Range	:	0 – 500 mm/minute.
Motor	:	Three Phases, Voltage 440 Volt AC
Drive	:	440 V, 3 Phase input, 3 Phase output
Salzer Switch	:	Mains ON/OFF Switch
Emergency Swi	tch:	To prevent load cell and accessories (Emergency stop to prevent any damage)

### 2.1 Introduction to EIE – Universal Testing Machine

Parts of Universal Testing Machine – Digital Controller

Structure:	Components and parts are fabricated from high grade stainless steel/mild steel
	material, which are hard chrome plated, wherever required and Powder coated in
	attractive shades.
Motor:	Electrical motor for speed variation between range of 0.001-500 mm/min.
Gear:	Gear is fitted for altering the RPM of motor respectively as per test requirement.
Pulley:	Pulley is fitted to maintain ratio of max.& min. speed requirement of machine
Two Tie Rods:	To support movement of middle plate up and down with fine guide
Double Screw:	To drive and support up/down movement of middle acting plate
Top Plate:	Acts as support for mounting the load cells/Stationary grip
Base Plate:	Acts as support for mounting the Load cells/Stationary grip.
Grip Jaw:	It is used to clamp test specimen (According to specific test)
Control Panel:	Controlling accessories for operating the machine.
Limit switch:	To prevent the moving crossheads from exceeding the pre – set range.
Instrument:	Load and extension/compression data transfer module.

### 3 Safety

- All EIE equipment is designed to be operated with the highest level of safety. This manual use note, caution and warning symbols throughout to draw your attention to important operational and safety information.
- Read and follow these important instructions. Failure to observe these instructions can result in permanent damage to the unit, significant property damage, personal injury.



Operation & Maintenance Ins	struction Manual
Equipment Name: Universal Testing Machine (Adhesive)	Equipment Serial Number:
Document Number: EIE/OM/UTMA/01	Page No.: 7 of 21

### 3.1 Safety Instructions



Read and understand all instructions and safety precautions listed in this manual before installing or operating your unit. If you have any questions regarding operation of the unit or instructions in this manual, contact our service Department.



Thoroughly understand the safety features and operation of the equipment. This manual will provide operators with safety concerns and general procedures. Be familiar with correct operating principals and use good judgement. Also refer to the appropriate manuals for system component safety instruction manuals.



Obey all national and local electric code requirements.



Dangerous high voltages present. Do not attempt to open the enclosure or gain to areas where you are not instructed to do so. Refer servicing to qualified service personnel only.



# Operation & Maintenance Instruction Manual Equipment Name: Universal Testing Machine (Adhesive) Equipment Serial Number: Document Number: EIE/OM/UTMA/01 Page No.: 8 of 21

### 4 Installation of Universal Testing Machine (UTM)

- Remove the shipping crate and packing material immediately upon receipt. Inspect for any sign of damage incurred during shipment. If any damage found, immediately discuss it with the delivery person and contact to transport company immediately. Also make notes of any damages on the bill of landing.
- 2. Retain all shipping material for later inspection.
- 3. Check packing slip carefully and ensure all materials have been received as indicated in packing slip.
- 4. Please, inspect and note whether any part of the instrument or any accessory is missing according to packing slip? If it is so, then immediately make note of it and report to the manufacturer.
- 5. Due to the vibration incurred during shipping and handling, it is possible that mechanical connection could become loose. Inspect all connection to ensure that they are secure.
- 6. After visual inspection, if everything is found to be okay, transit the instrument to suitable safe place where it is intended to install. **Caution: Handle with care.**
- 7. Lift the instrument from the shipping pallet by lifting under the base or the upper crosshead. Do not lift the by loading (lower) crosshead. If using a fork lift, make sure the forks are fully supporting the front and back of the base otherwise damage may occur to components under the base.
- 8. Recycle the packing material. Do not throw it away for environment protection.
- 9. Place the unit on a plain, even and sturdy surface leaving 12-18" space away from the wall.
- 10. Do not install unit in a corrosive environment. A corrosive environment may lead to poor performance and deterioration of unit.
- 11. Do not place the equipment in a draft, sunlight or near a place of equipment, which emits heat as well as electromagnetic conduction emission.
- 12. Keep the standard operating procedure and the respective standard handy to conduct the test.



# Operation & Maintenance Instruction Manual Equipment Name: Universal Testing Machine (Adhesive) Equipment Serial Number: Document Number: EIE/OM/UTMA/01 Page No.: 9 of 21

### 4.1 Component Diagram of Universal Testing Machine (Digital Controller Based)



ID	DESCRIPTION	ID	DESCRIPTION
1	Casing for Timing Pulley and Belt	9	Angle Structure
2	Casing For Guide Rod & Screw	10	Load Cell
3	Limit switch Unit	11	Control Panel
4	Chip cover	12	Digital Controller (Load Indicator)
5	Movable (acting) Plate	13	Emergency switch
6	Bottom Plate	14	Mains Indicator
7	Base sheet (Body)	15	Mains Switch
8	Side & front Body Covers		

Figure 1 Component Diagram of UTM



## Operation & Maintenance Instruction Manual Equipment Name: Universal Testing Machine (Adhesive) Equipment Serial Number: Document Number: EIE/OM/UTMA/01 Page No.: 10 of 21



### 4.2 Electrical Circuit Diagram of Universal Testing Machine





### 5 Introduction to Digital Controller of Universal Testing Machine



- 1 : FWD Indicator Glows when the acting plate is moving in Forward mode.
- 2 : REV Indicator Glows when the acting plate is moving in reverse mode.
- 3 : Display

### **Functioning Keys of Digital Controller**

direction depends on test type selected mode)STOPTo stop the functioning of acting plate.REVTo move the acting plate in reverse direction.
STOPTo stop the functioning of acting plate.REVTo move the acting plate in reverse direction.
<b>REV</b> To move the acting plate in reverse direction.
SET To enter in parameter setting mode.
UP KEY To Increase parameter values in set mode.
DOWN KEY To decrease parameter values in set mode.
To confirm/save changed parameter values in setting mode. It is also used to
return back to home screen window from set mode.
TARETo nullify the load value which occurs before starting actual test process.

Table 1 UTM Functional Keys

### 5.1 Operating Instruction of Digital Controller

- Plug the mains power chord to the respective 3 pin socket (440 volts 50 Hz three phase).
- Turn "ON" the main switch (Salzer) mounted on the control panel of the unit.
- Display of the control glows, indicating that the unit is in functioning mode, displaying following parameters as shown in figure: 3.

stiffegant & Re	Operation & Maintenance Instruction Manual	
	Equipment Name: Universal Testing Machine (Adhesive)	Equipment Serial Number:
EIE INSTRUMENTS	Document Number: EIE/OM/UTMA/01	Page No.: 12 of 21

## Act. Load : 0001.1K9 Extenction: 000.0 mm Peak Load:0001.4 K9 Peak Load Ext:002.1

### Figure 3 Home screen

Actual Load : It indicates actual load being applied on the sample during test process. (In KG)

Elongation : It indicates the travelling distance of the moving platen. (In MM)

Peak Load : It indicates the maximum load at which sample fails/ruptures.

Peak Load ext. : It indicates the distance at which at which sample tears completely.

NOTE: Actual result will be indicated after the completion of test or failure of sample.

- Before processing for the actual test process, follow few steps as explained below:
- Press & hold "SET" button for 2 seconds, to enter in set mode. immediately auto reverse function window will open, showing current status of the function, i.e. "ON", as shown in the figure 4.



Figure 4 Auto rev. function

- User can turn it ON/OFF using UP/DOWN button respectively. (*Recommended to turn it ON always*)
- Again have a long Press on "SET" button, test selection window will open as shown in figure: 5.
- select test type as per preparation and need of test (i.e. TENSILE/COMPRESSION/FLEXURAL). User can scroll different test type using "UP & DOWN" button and then press "ENTER" button to select the test type.



	<b>Operation &amp; Maintenance Instruction Manual</b>	
	Equipment Name: Universal Testing Machine (Adhesive)	Equipment Serial Number:
r ltd	Document Number: EIE/OM/UTMA/01	Page No.: 13 of 21



Figure 5 Test Selection window

• By pressing "SET" three times, Factory setting window open, which is password protected, an authorized person is only permitted to use this window. (*Caution: Do not alter these settings*)



Figure 6 setting window

• This is used for calibration and other important settings.

NOTE: "FACTORY SET" settings, do not need any changes.

### 5.2 Speed Setting Process

Press & hold "SET" button for 2 - 3 seconds, to enter in set mode, scroll using set button until the screen displays the sample test speed on the screen as shown in figure: 7.



### Figure 7 Speed checking screen

Now using "UP & DOWN" arrow buttons, increase/decrease the speed of test respectively.



& Rel	<b>Operation &amp; Maintenance Instruction Manual</b>	
able	Equipment Name: Universal Testing Machine (Adhesive)	Equipment Serial Number:
NTS PVT LTD	Document Number: EIE/OM/UTMA/01	Page No.: 14 of 21

### 6 Standard Operation Procedure

- 6.1 Determination of Tensile Adhesive Strength
- Prepare five test piece of tiles of size (50 mm ± 1 mm × 50 mm ± 1 mm × 6mm) according to IS
   15477.
- Mount the hook type grip (jaws) to Load cell 1 (i.e. 3000 KG) which is mounted on top crosshead.



Figure 8 Test Grip for Tensile Adhesive test

- Remove the test unit from conditioning environment and insert it in the test unit holder mounted in tensile testing machine and it must be centrally clamped. (It is recommended to use vice for adjustment and better accuracy)
- Select the test type to "TENSILE" from test type selection mode (as explained in figure: 5), press enter button after selecting tensile test, following window will open as shown in figure:



### Figure 9 Tensile test speed screen

- For tensile adhesive test, set the speed of test i.e. 250 N/min (25 kg/sec) is factory set for Tensile Adhesive Test as per standard) as per prescribed in standard.
- TARE the load to (000.0) on the instrument display (if any load is recorded while placing the sample or during adjustment) using "TARE" button.
- Now start the test by pressing "FWD" button, immediately acting plate will start moving in forward direction (downward direction).



- Note the tensile adhesion strength of the test unit. Then test each of the other test units similarly.
- If one or both of the tiles in any test unit are broken in the test, Record the value at which the breakage occurred. (Include it in mean calculation)
- After failure/ rupture of sample, machine will auto reverse to its original position.
   NOTE: Be careful during the process, if acting plate not stops automatically after reaching to its original position, stop the machine using "STOP" button or Emergency switch.
- If the value is within ± 15 percent of the mean value, discard any individual result in which the breaking force differs by more than 15 percent from the mean value.

### 6.2 Determination of Shear Adhesive Strength

- Place 108 mm×108 mm×6.5 mm test piece tile on a plane horizontal surface and locate the jig over the tile and against one corner of it.
- Replace the grips as per test, which is supplied with the machine, mount the grip in acting plate tightly and compressing head to the load cell 1. (as shown in figure: 10)



Figure 10 Test grip for Shear adhesive test

- Remove the test unit from conditioning, insert it into the test unit holder mounted in the Universal testing machine.
- Fix the sample centrally with respect to the compressing head, tight the sample using the slider and lock it using the knob. Caution: Do not apply high force, as it may damage the sample
- Select the test type to "COMPRESSION" from test type selection mode (as explained in figure: 5)
- After that Set the test speed of the cross –head (acting plate) to **5 mm/ minute**.
- TARE the load to (000.0) on the instrument display (if any load is recorded while placing the sample or during adjustment) using "TARE" button.



- Now start the test by pressing "FWD" button, immediately acting plate will start moving in forward direction (Upward direction).
- Failure of the unit shall be deemed to have occurred when the applied force reaches a maximum value.
- Then test each of the other test units similarly.
- If one or both of the test tiles are broken in the test, record the value at which breakage occurs, and include it in the mean shear adhesion strength calculation,
- After failure/ rupture of sample, machine will auto reverse to its original position.

NOTE: Be careful during the process, if acting plate not stops automatically after reaching to its original position, stop the machine using "STOP" button or Emergency switch.

• If the value is within ± 15 percent of the mean value, discard any individual result in which the breaking force differs by more than 15 percent from the mean value.

### 6.3 Deformation Test

For deformation test user needs, to do respective changes as explained below:

- Mount LOAD CELL 2 (500 KG) in the lower end of the Load Cell 1 and clamp the anvil to the load cell2 tightly.
- After that place the Test Jig (supporting span) on the moving crosshead (acting plate) of the machine. (as shown in figure: 11)



Figure 11 Deformation test assembling

 Mark a centre point on the Anvil circumference, to adjust the test jig assembly and laser sensor centrally.

### NOTE: Adjust the laser sensor light carefully, as it is very precise and its affects test accuracy.

• Prepare the sample of  $300 \pm 1 \text{ mm} \times 45 \pm 1 \text{ mm} \times 3 \pm 0.005 \text{ mm}$ , according to **IS 15477**.



- Place test piece on supporting rod of Test jig horizontally, and check the beam of laser light, it must be in centre of the sample.
- Select the test type to "FLEXURAL" from test type selection mode (as explained in figure: 5)
- After that Set the test speed of the cross –head (acting plate) to 2 mm/ minute.
- TARE the load of "DEFORMATION" to (000.0) on the display using "**UP ARROW**" button (to nullify the deflection recorded while placing the sample or during adjustment).
- Now start the test by pressing "FWD" button, immediately acting plate will start moving in forward direction (Upward direction).
- Failure of the unit shall be deemed to have occurred when the applied force reaches a maximum value.
- Then test each of the other test units similarly.
- If one or both of the test samples are broken in the test, record the value at which breakage occurs, and include it in the mean deformation strength calculation,
- After failure/ rupture of sample, machine will auto reverse to its original position.
   NOTE: Be careful during the process, if acting plate not stops automatically after reaching to its original position, stop the machine using "STOP" button or Emergency switch.

### 7 Precautions to Followed

The following statements are CAUTION statements. These statements alert the operator to conditions that may damage equipment. Operators must be aware of these conditions to ensure safe operation of this equipment.

- Set the adjustable limit switches prior to test operation. The limit switches prevent the moving crosshead (acting plate) from exceeding the pre-set range. Set the limit switches just above and below the range set for the moving crosshead.
- If necessary, stop test operation in case of emergency. Use the emergency Stop button on the UTM to abort test operation.
- 3) Do not exceed the rated capacity of the adapter, grips, or load cell.
- 4) Do not lift the UTM by its loading crosshead or it may damage the machine. Lift only under the housing or by the adjustable crosshead.
- 5) Be sure the correct load cell in use is selected in the load cell configuration menu.
- 6) Test capacity is determined by the smallest load cell in a load train regardless of which cell is connected. If higher capacity is needed, switch as explained.

sy flegant & Pa	<b>Operation &amp; Maintenance Instruction Manual</b>	
Stur Star	Equipment Name: Universal Testing Machine (Adhesive)	Equipment Serial Number:
EIE INSTRUMENTS PVT LTD	Document Number: EIE/OM/UTMA/01	Page No.: 18 of 21

- 7) Observe maximum temperature ratings of test Components (extensometer, grips, fixtures, couplings, etc.)
- 8) Avoid ramming grips and fixtures together at high speeds. The load cell protection feature may not react fast enough to avoid damage to load cell.
- 9) While cleaning take care that the small/ sensitive parts do not get damaged.
- 10) Keep the instrument tidy, clean and dry with mint cream. Before initiating the fresh day, use preferably clean soft cloth. Brush up the unit body as to maintain its finishing and shine.
- 11) Place the unit in plane and even surface only, otherwise inaccuracy may occur.
- 12) Mount respective set of the jaws carefully and must be fitted tightly.
- Always connect to 440 volts, 3 phase, AC supply and in proper grounded outlet to prevent electric shocks.
- 14) After completion of test remove the test units and tiles from the instrument.
- 15) Disassembly of this equipment is strictly limited to the qualified persons and licensed engineers only.
- 16) In case of any difficulty, please do not try to repair without consulting the manufacturer, especially when the instrument is under the warranty period.



<b>Operation &amp; Maintenance Instruction Manual</b>	
Equipment Name: Universal Testing Machine (Adhesive)	Equipment Serial Number:
Document Number: EIE/OM/UTMA/01	Page No.: 19 of 21

### **Warranty Certificate**

Your EIE product is guaranteed to be free from defects in materials and workmanship for one (1) year under normal use from the date of purchase. This warranty does not apply to any product damaged by accident, misuse, mishandling, abuse, negligence, transit, improper line voltage, drop, fire, flood or if the products were altered or repaired by anyone other than the qualified service personnel. The liability of EIE Instruments is limited to repair or replacement and under no circumstances shall EIE be liable for any collateral consequential damages or loss. This guarantee specifically excludes the expendables and consumables. All warranty claims must be directed to your corresponding purchase organization that is responsible for the sale of this equipment. The users are responsible for shipping expense. The warranty cards which are not signed and stamped by the actual user will be treated as void. The warranty card should accompany the defective products sent for repair, without which no claims would be entertained. Please detach the below warranty card from following cut-line.

Attributes	Details
Name of the Company	
Address	
Telephone Number	
Mobile Number	
Email Address	
Date of Purchase	
Product Model	
Serial Number	
Bill or Cash Memo Number	

This card should be detached, filled in properly and posted within 15 days from the date of purchase otherwise the warranty becomes invalid.

SHELEBOAT & AB	Operation & Maintenance Instruction Manual	
	Equipment Name: Universal Testing Machine (Adhesive)	Equipment Serial Number:
	Document Number: EIE/OM/UTMA/01	Page No.: 20 of 21

## - End of Document -

If you have any note or queries,

Please write to us at info@eieinstruments.com, Thank you!

Our other range of products...

Pharma & Microbiology Lab Testing Instruments	Yarn & Fabric Testing Instruments
Paper & Packaging Testing Instruments	Geotextile Testing Instruments
Ceramic Tiles Testing Instruments	ISO 17025 Accredited Calibration Lab



www.eieinstruments.com | www.eiepharmatest.com

www.eiepetrotest.com | www.eieceratest.com

#### Corporate Office EIE INSTRUMENTS PVT. LTD.

A-1301, BVR EK BUILDING, Gujarat College Road, Opp. Inder Residency, Ellis bridge, Ahmedabad, Gujarat-380006, India Website: www.eieinstruments.com Phone Number: +91-79-66211234, Email Address: info@eieinstruments.com Calibration Laboratory EIE INSTRUMENTS PVT. LTD.

B-14, Zaveri Industrial Estate, Kathwada Singarva Road, Opp. Shyam, villa Society, Kathwada, Ahmedabad, Gujarat - 382430, India Phone Number: +91-79-66040660, +91-79-66040600 Website: www.eieinstruments.com



<b>Operation &amp; Maintenance Instruction Manual</b>		
Equipment Name: Universal Testing Machine (Adhesive)	Equipment Serial Number:	
Document Number: EIE/OM/UTMA/01	Page No.: 21 of 21	